


## Leadout Line

---



You can test the lead in by selecting the “plot item” command and viewing the tool path.

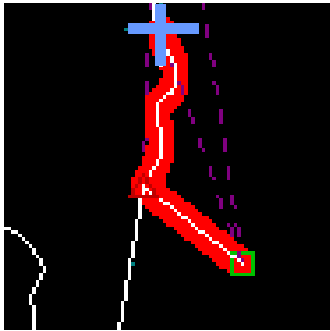


— LEAD OUT

— LEAD IN



The “leadout” command provides an exit path for the tool. The procedure is the same, except when joining the lead out, select the object first and then the leadout line.

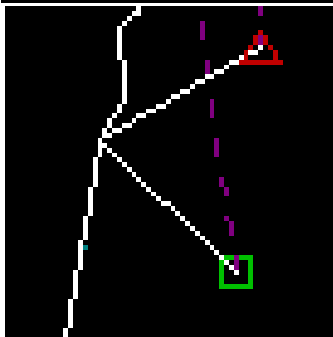

Notice the green square indicates the line start point for the lead in line and the red triangle shows the end of the lead out line.

---